

WHAT'S NEW


SUPPORT FOR SATURN ZEN UNITS

This release contains commissioning support for a new unit range called 'Saturn Zen'. This includes unit types KEYH1, KEYH2, KEYH3, and KEYH4.

SENSOR RAPID COMMISSIONING

There is a new 'Rapid Commissioning' UI for the following unit types:

- SENPILL FW V2.3.00 and V2.4.00
- SENPIRIB FW V2.4.00

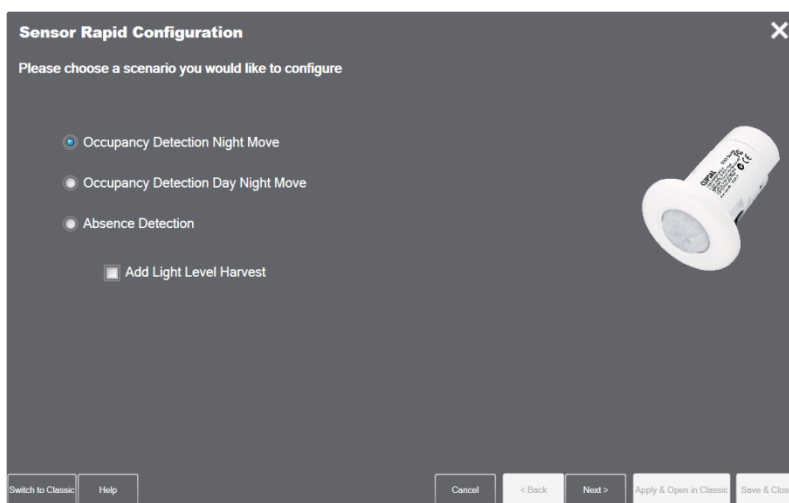

This new UI is shown by default and presents a simple step-by-step wizard designed to cover the majority of use cases.

It is possible to switch between the Rapid Commissioning and the traditional UI.

NO LONGER AVAILABLE ON WINDOWS XP

Clipsal by Schneider Electric ceased technical support for Windows XP in April 2014, in line with Microsoft's End of Life schedule.

C-Bus Toolkit now uses .NET Framework 4.5.2. This version of .NET is not available for Windows XP, as a result C-Bus Toolkit will no longer install or work correctly on that operating system.

OTHER FIXES

- TK-9989 - Fatal Error when opening EDLT unit
- TK-10369 - Toolkit launches behind other applications
- TK-7844 - Upgrade Open SSL Library
- TK-7981 - Product image missing in CTC3 GUI
- TK-10051 - EDLT lighting widget Key function resets its value after reopening
- TK-10266 -TK Can not minimize correctly on the task bar in Win 7
- TK-8008 – Help File - Links for all Tabs in SENTEMP4 dialog box do not come up on right hand side pane
- TK-9720 – Help File - Update for Customer Site Fix (SENPILL + FW 2.4)
- TK-7600 – Help File - Theres no help link for DLT Labels (Dynamic Labelling Technology)

WHAT'S NEW

JAVA 7 UPDATE

C-Gate now uses a Java 7 JRE instead of Java 6. Several libraries have been updated.

TRANSMIT CACHE

C-Gate now caches an outgoing C-Bus command if it is identical to one already in progress. The subsequent instance(s) of the command will not be sent to C-Bus but will assume the response received by the first instance. C-Gate client applications are unaffected but the “cached command” will be noted in the C-Gate log. It is recommended to leave this feature enabled but if necessary you can disable it as follows:

```
cbus.tx-cache=no
```

OPTIONS TO REDUCE NETWORK TRAFFIC

There are new config options which reduce the amount of traffic caused by background syncs. Testing has shown a reduction of 20%-40% in the number of queries performed by C-Gate. It is believed the majority of sites will not be affected by this reduced amount of data.

To implement this add the following seven lines to your C-GateConfig.txt file and restart C-Gate.

```
sync.app-stage.psync=no  
sync.unit-parameter.project=9  
sync.unit-parameter.areaaddress=9  
sync.unit-parameter.patchversion=9  
sync.unit-parameter.currentsenselevels=9  
sync.unit-parameter.unitsummary=9  
sync.unit-parameter.physicaloutputlevels=9
```

Note that the units in C-Gate’s model will now have a few properties with null values. This should not impact C-Bus Toolkit or Schedule Plus but other Clipsal applications and third-party client applications may well be affected.

To revert to the original behavior simply remove these seven lines again from your C-GateConfig.txt file.

PCI POLLING FIXES

This release fixes a bug in the PCI polling feature that caused networks to go into error. It also fixed a bug where PCI polling could not be disabled.

Should you continue to encounter issues at times when you see PCI polling in the C-Gate log, you can disable it as follows:

```
network.pci.poll-interval=0
```

Note that disabling PCI polling will revert to the historical behaviour seen in C-Gate versions prior to v2.9.5 where networks would not go into error for up to an hour after the gateway unit had gone offline.

CONFIG OBRESET

This new command provides the ability to reset any customised config options associated with a project or network.

For example to reset an entire tag database file to the default config values use the following command sequence:

```
PROJECT LOAD MYPROJ
200 OK.
CONFIG OBRESET MYPROJ
200 OK.
PROJECT SAVE MYPROJ
200 OK.
```

C-GATE MANUAL

The C-Gate Manual has received several updates. Of particular note is a new section: **Reference -> Networks** which provides extensive detail on how C-Gate synchronizes networks and manages their error states.

KNOWN ISSUES

JRE Downgrade

If you downgrade (by re-installing an older C-Gate version over the top) the Java 7 JRE will not be removed. The older C-Gate will have both a /jre7 and a /jre6 subdirectory and it will still be using the Java 7 JRE. While it should still work this is not a tested configuration. You can correct this by editing cgate.ini as follows:

```
JAVA_DIR=jre6
```